


# Field Installation of a Slave Kit in a Heat PumPro Panel

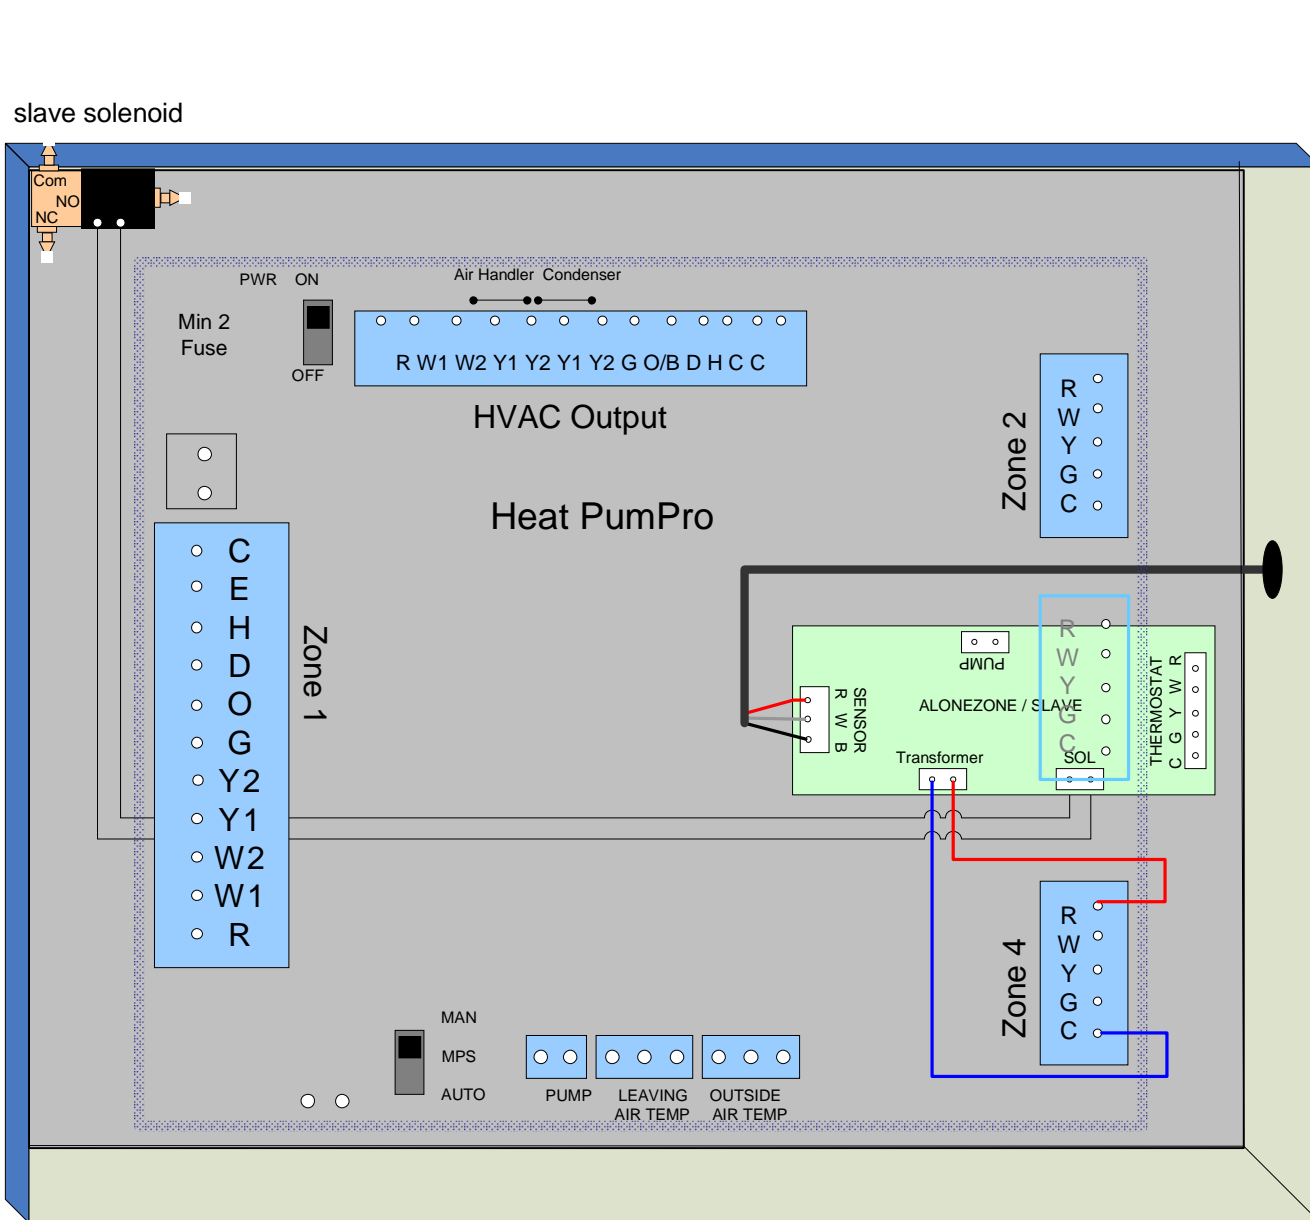

Mount the Slave Board behind the HPP  
PC Brd  
*Holes will need to be field drilled in the back of the  
panel for the aluminum stand-offs*

“Trans” terminals can be wired to “R” & “C”  
of **any** zone

Slave LAT Sensor is installed in the  
Supply duct in the same area as the HPP  
LAT sensor

Mount the Slave Solenoid at the pre-drilled  
slot on the Left side of the top of the box

Plumb the Slave tubing identical to the  
Zone solenoids by adding tees to the  
press/vac tubing from the pump

Com port Up (Zone Tubing)  
N/O port to Vac tube (purple)  
N/C port to press tube (yellow)

“PUMP” terminal is not used

Description: Slave Zone Field Kit Installation in a HeatPumPro Panel

Drawing Number:

Drawn By: jcr

Date Drawn: 01/08/2010

Revision Date: 10/06/2010

Arzel Zoning Technology, Inc.  
4801 Commerce Parkway  
Cleveland, OH 4128  
Ph: 800-611-8312  
www.arzelzoning.com

